


# STANDARD INSTRUMENT DEPARTURE CHART (SID)- DELHI

BEARINGS ARE MAGNETIC. ALT. IN FEET.  
COORDS. OF FIX AND FACILITIES IN WGS-84.  
DISTANCES ARE IN NM.

RWY 28/27  
ALI 1A, ALI 1C  
ALI 1E, ALI 1F  
PUMOT 1A, PUMOT 1C

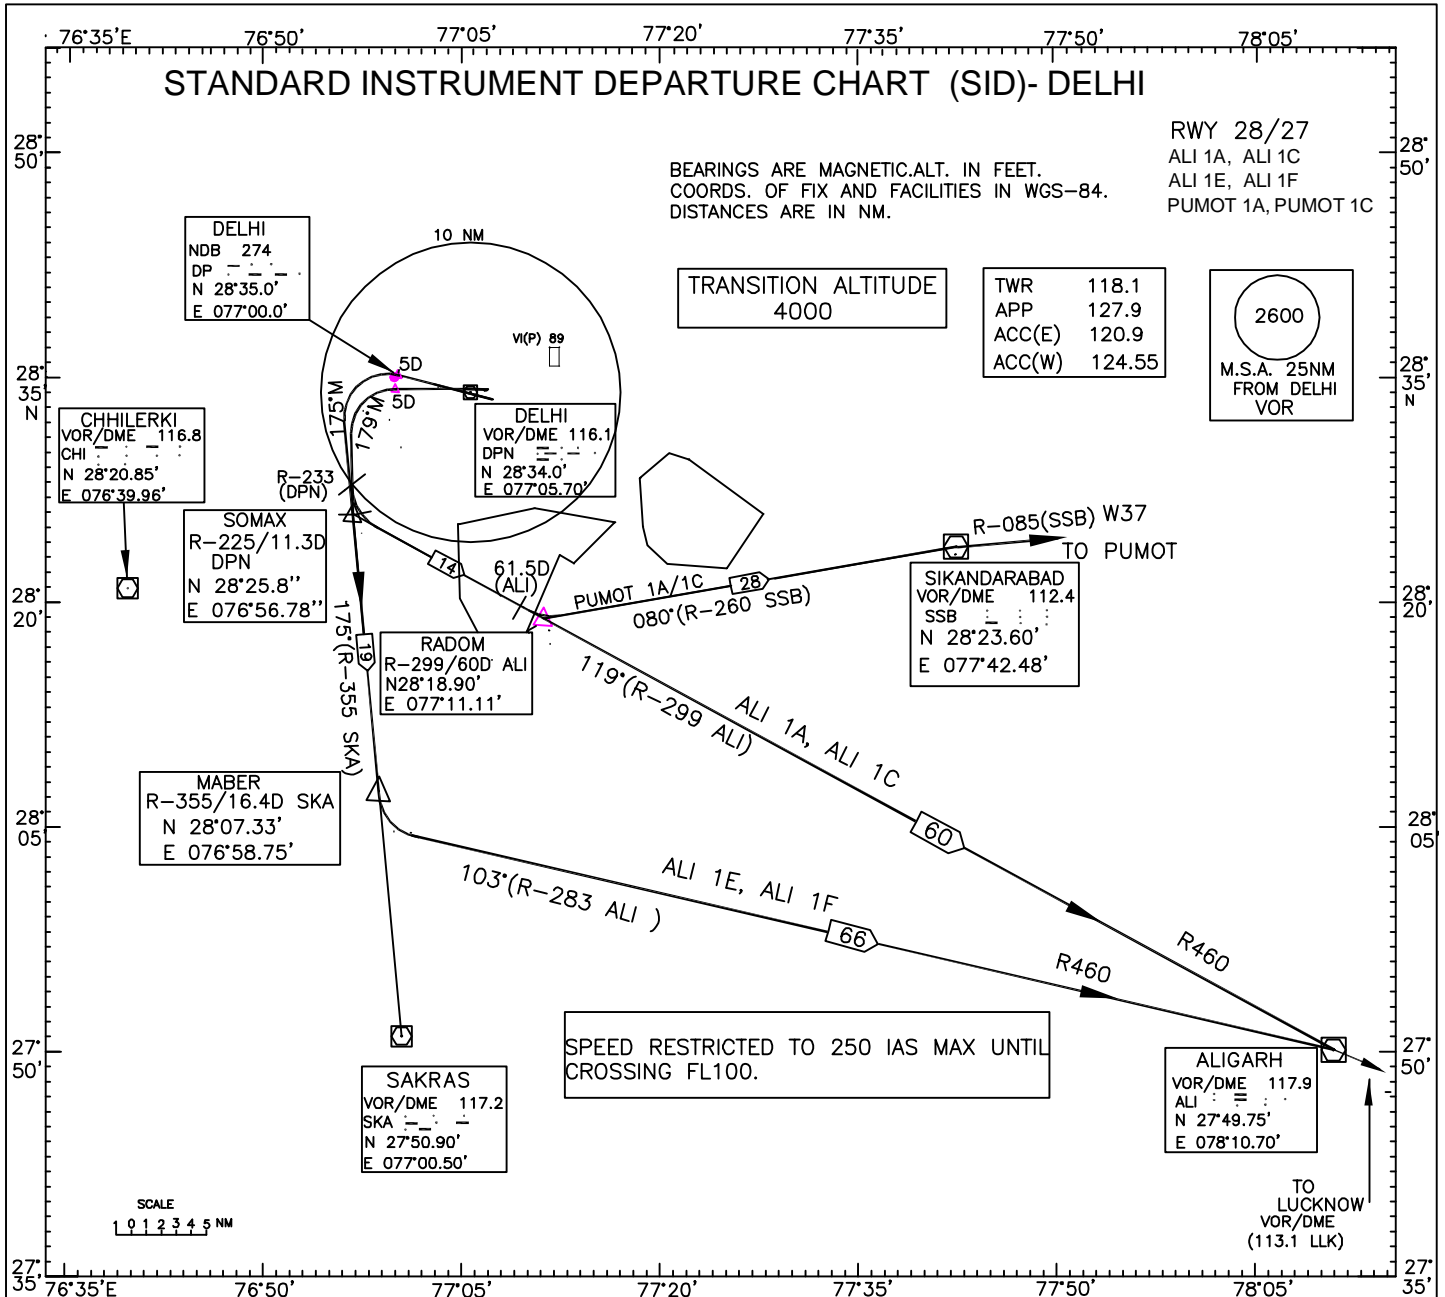

FOR ALL SIDs AFTER DEPARTURE CLIMB INITIALLY TO FL55 OR AS CLEARED BY ATC.

- ALI 1A :** Climb straight ahead until 5D (DPN). Turn left track 175°M to SOMAX. Crossing R-233 (DPN) turn left to establish R-299 (ALI) to ALIGARH VOR/DME(117.9 ALI).  
RWY 28 (Not available when Tughlakabad range VID139 is active)
- ALI 1C :** Climb straight ahead until 5D (DPN). Turn left track 179°M to SOMAX. Crossing R-233 (DPN) turn left to establish R-299 (ALI) to ALIGARH VOR/DME(117.9 ALI).  
RWY 27
- ALI 1E :** Climb straight ahead until 5D (DPN). Turn left track 175°M to establish R-355 (SKA) to MABER. Then turn left to establish R-283 (ALI) to ALIGARH VOR DME. Then to LUCKNOW VOR DME(113.1 LLK).  
RWY 28
- ALI 1F :** Climb straight ahead until 5D (DPN). Turn left track 179°M to establish R-355 (SKA) to MABER. Then turn left to establish R-283 (ALI) to ALIGARH VOR DME(117.9 ALI).  
RWY 27
- PUMOT 1A :** Climb straight ahead until 5D (DPN). Then turn left track 175°M to SOMAX. Crossing R-233 (DPN) turn left to establish R-299 (ALI) to RADOM. Crossing 61.5D (ALI) turn left to establish R-260 (SSB) to Sikkandarabad VOR DME (112.4 SSB). Then to PUMOT.  
RWY 28
- PUMOT 1C :** Climb straight ahead until 5D (DPN). Then turn left track 179°M to SOMAX. Crossing R-233 (DPN) turn left to establish R-299 (ALI) to RADOM. Crossing 61.5D (ALI) turn left to establish R-260 (SSB) to Sikkandarabad VOR DME (112.4 SSB). Then to PUMOT.  
RWY 27